

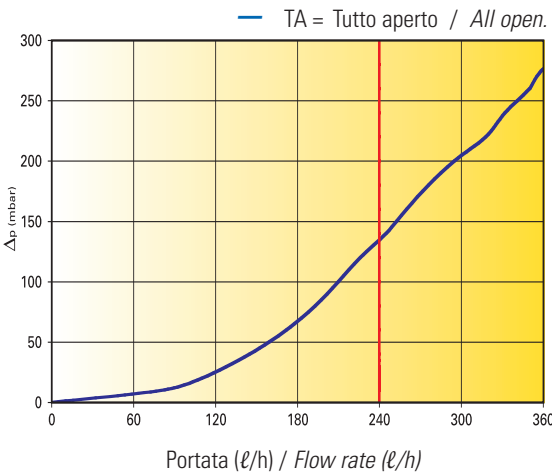


## Top Way collettore di mandata nichelato, con misuratore di portata Top Way flow manifold nickel-plated, with flow meters included

### Perdite di carico Pressure drop

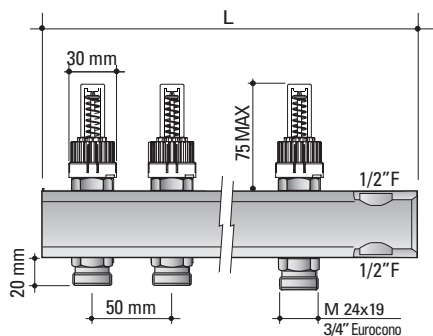


### Valori di Kv Misuratore 4 l/min Kv values flow meter 4 l/min

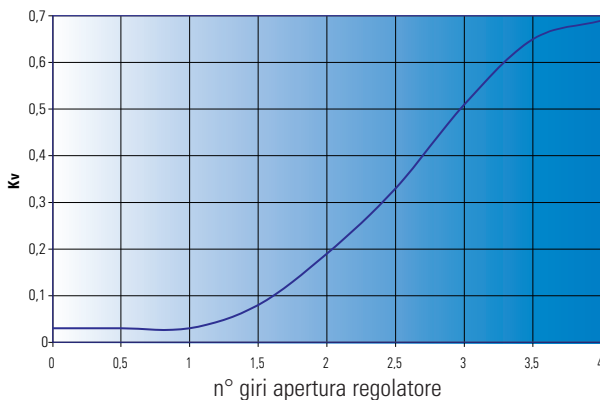

Modello Type		2 vie 2 ways	3 vie 3 ways	4 vie 4 ways	5 vie 5 ways	6 vie 6 ways	7 vie 7 ways	8 vie 8 ways	9 vie 9 ways	10 vie 10 ways	11 vie 11 ways	12 vie 12 ways
1"	L mm	164	214	264	314	364	414	464	514	564	614	664
1 1/4"	L mm	170	220	270	320	370	420	470	520	570	620	670

Nota: interasse derivazioni 50 mm / Note: distance between takeoffs 50 mm

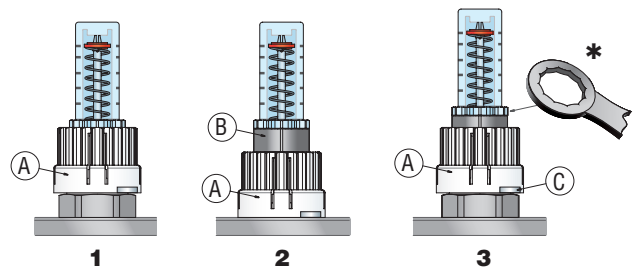

### Regolazione

L'operazione di regolazione si effettua nel seguente modo:

1. Sollevare la ghiera (A) e ruotarla manualmente, in senso antiorario, fino a completa apertura del detentore.
2. Abbassare la ghiera (A) ed effettuare la taratura agendo sul regolatore (B) fino a raggiungere la portata corretta (indicata direttamente dal misuratore).
3. Alzare la ghiera (A) fino ad avvertire lo scatto che segnala il corretto posizionamento della stessa.

**Nota: Tutte le suddette operazioni vanno eseguite manualmente.**

È inoltre possibile sigillare, mediante piombatura, la ghiera nella posizione raggiunta sfruttando i fori presenti nelle alette (C) per assicurarla:

- direttamente al collettore, impedendo qualsiasi manomissione;
- al misuratore, lasciando la possibilità di intercettare la via senza modificare la taratura di massima apertura impostata.

### Pulizia del vetrino

- Ruotare la ghiera (A), in senso orario, fino a completa chiusura del detentore.
- Rimuovere il vetrino svitandolo dal regolatore (B) (\*).
- Effettuare la pulizia del vetrino e riavvitarlo sul regolatore (B).
- Ruotare la ghiera (A), in senso antiorario, fino a completa apertura del detentore.

### Adjustment

The adjustment operation is carried out in the following way:

1. Raise the ring nut (A) and turn it manually anticlockwise until the stopper is completely open.
2. Lower the ring nut (A), and calibrate using the adjuster (B), until the correct flow is reached (directly indicated by the loading capacity flow scale in the clear window).
3. Raise the ring nut (A), until it clicks, indicating that it is in the correct position.

**Note: all of the above operations are to be done manually.**

It is also possible to seal the ring nut into this position using a lead seal and the holes in the vanes (C) to fasten it:

- directly to the manifold, preventing any tampering;
- to the flow meter, making it possible to intercept the flow without changing the set calibration for maximum opening.

### Cleaning the window

- Turn the ring nut (A), clockwise, until the lockshield is completely closed.
- Remove the window by unscrewing the adjuster (B) (\*).
- Clean the window and screw it back on with the adjuster (B).
- Turn the ring nut (A), anti-clockwise, until the lockshield is completely open.

Perdite di carico misuratore di portata - Flow rate measuring device pressure drops

